Kit Instructions

Remote Scale Display Mount (NCR 7895 Scanner/Scale)

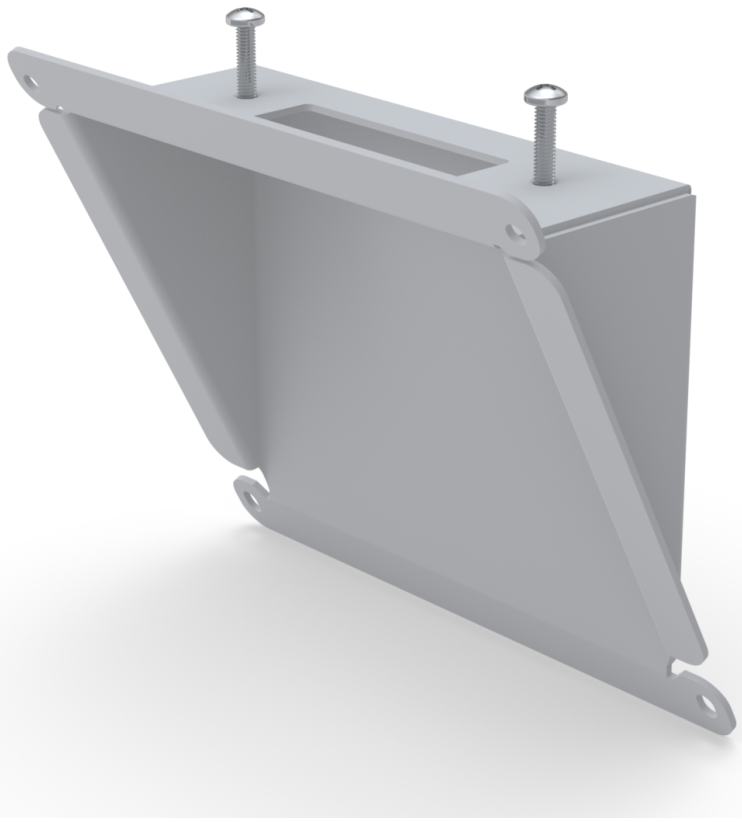

7357-K912
Issue A

The product described in this document is a licensed product of NCR Corporation.

NCR is a registered trademark of NCR Corporation. NCR FastLane SelfServ™ Checkout is a trademark of NCR Corporation in the United States and/or other countries. Other product names mentioned in this publication may be trademarks or registered trademarks of their respective companies and are hereby acknowledged.

The terms HDMI and HDMI High-Definition Multimedia Interface, and the HDMI Logo are trademarks or registered trademarks of HDMI Licensing LLC in the United States and other countries.

Where creation of derivative works, modifications or copies of this NCR copyrighted documentation is permitted under the terms and conditions of an agreement you have with NCR, NCR's copyright notice must be included.

It is the policy of NCR Corporation (NCR) to improve products as new technology, components, software, and firmware become available. NCR, therefore, reserves the right to change specifications without prior notice.

All features, functions, and operations described herein may not be marketed by NCR in all parts of the world. In some instances, photographs are of equipment prototypes. Software screen images are representative, and in some cases, may not match a customer's installed software exactly. Therefore, before using this document, consult with your NCR representative or NCR office for information that is applicable and current.

To maintain the quality of our publications, we need your comments on the accuracy, clarity, organization, and value of this book. Please use the link below to send your comments.

Email: FD230036@ncr.com

Copyright © 2021
By NCR Corporation
Global Headquarters
864 Spring St NW
Atlanta, GA 30308
U.S.A.
All Rights Reserved

Revision Record

Issue	Date	Remarks
A	July 2021	First Issue

Remote Scale Display Mount (NCR 7895 Scanner/Scale)

This publication provides the procedure for installing a Remote Scale Display Mount (NCR 7895 Scanner/Scale) to the NCR FastLane SelfServ™ Checkout (7357) R6LN Plus.

Kit Contents

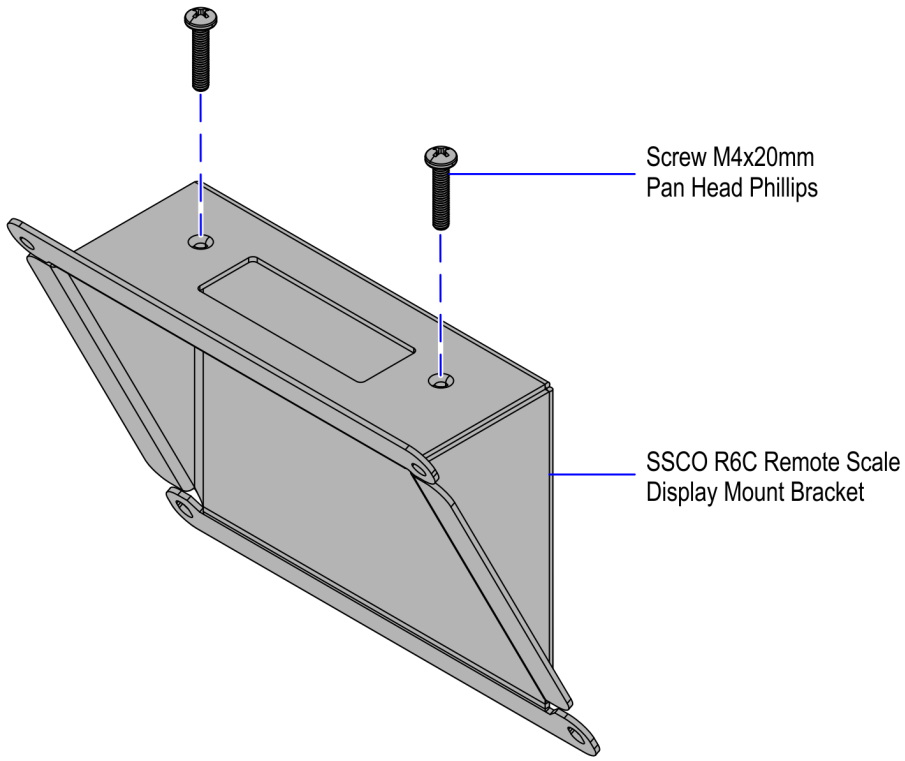

CCP-79734

Part Number	Description
497-0529324	SSCO R6LN+ (7895 Scanner) Remote Scale Display Mount Kit
497-0529325	SCCO R6C Remote Scale Display Mount Bracket
006-8622923	M4x20mm Pan Head Phillips SS Machine Screw (2 pcs)

Installation Procedure

To install the Remote Scale Display Mount (NCR 7895 Scanner/Scale), follow these steps:

1. Shut down the NCR FastLane SelfServ™ Checkout software and hardware systems.
2. Remove the Terminal Display by doing the following:
   a. Remove two (2) screws that are securing the Display Mounting Bracket on the Tower Frame.

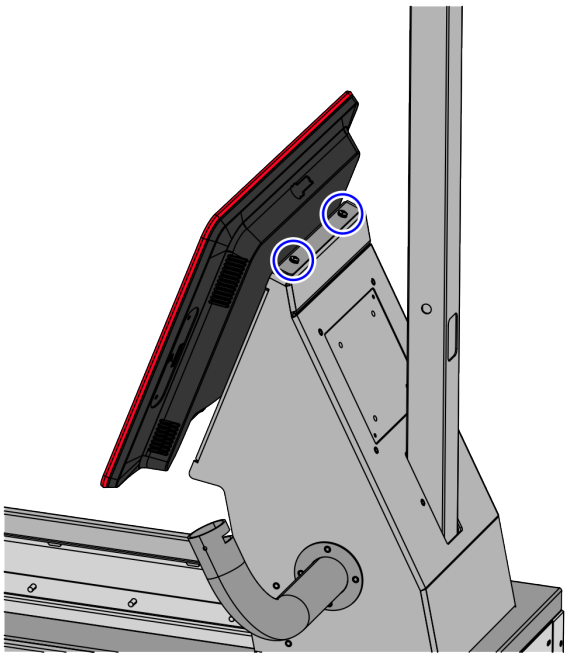

CCP-79790

   b. Slide up the Display to disengage the mount hooks from the core.

c. Lift and tilt the Display forward, as shown in the image below.

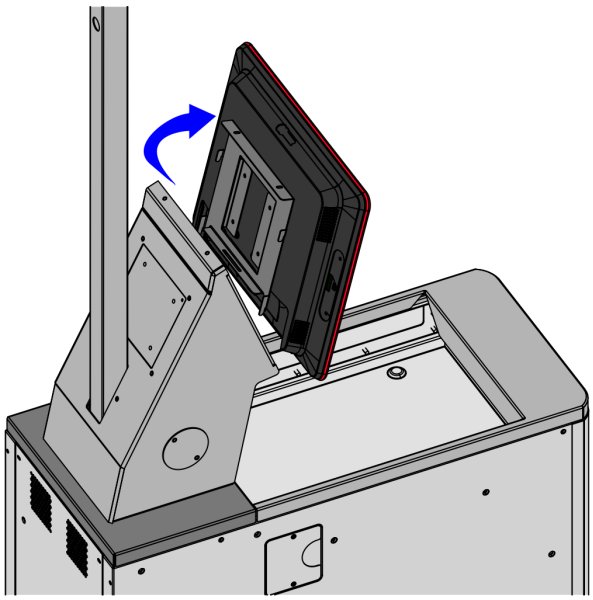

CCP-76104

d. Disconnect the Display cables.

3. Open the Core Door.
4. Remove the Scanner Top by sliding it forward, as shown in the image below.

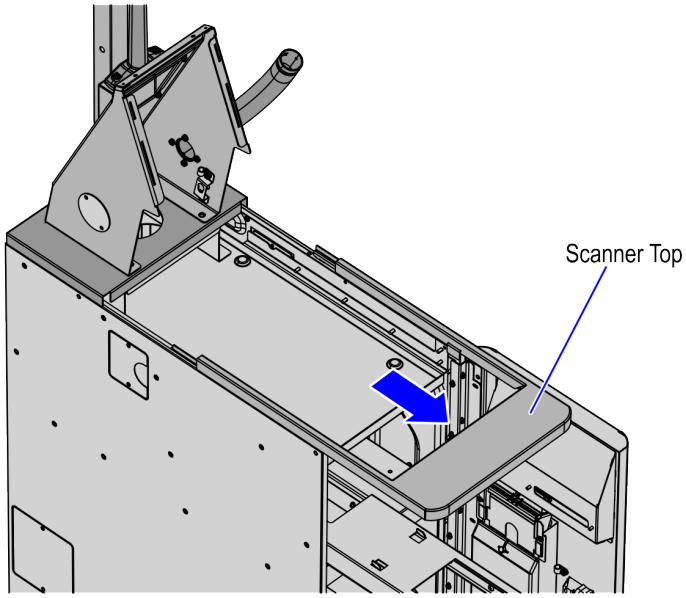

CCP-79775

5. Detach the Blank Plate from the back of the Tower Frame by removing four (4) nuts.

Note: Remove the nuts from the inside of the Tower Frame and discard the Blank Plate properly. Retain the four (4) nuts for installing the Remote Scale Display Mount.

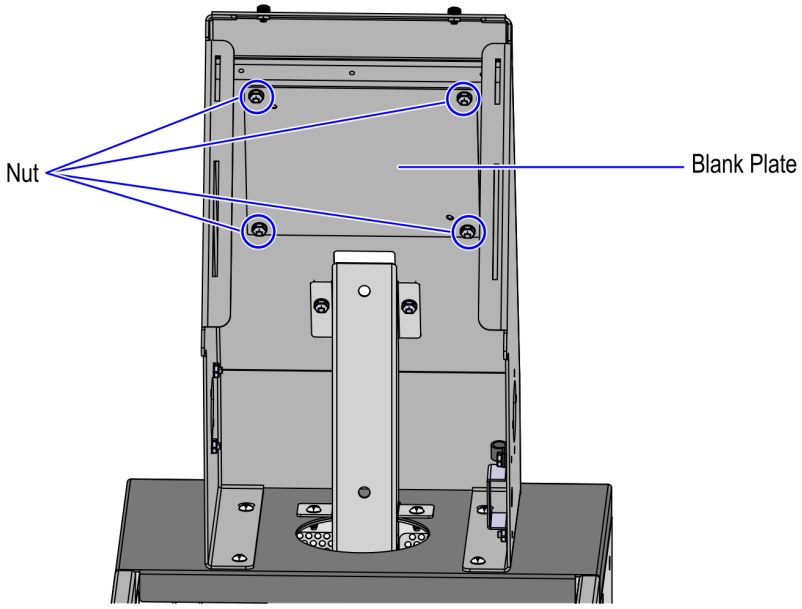

CCP-79737

6. Secure the Remote Scale Display Mount to the unit with four (4) nuts.

Note: Reuse the nuts previously set aside.

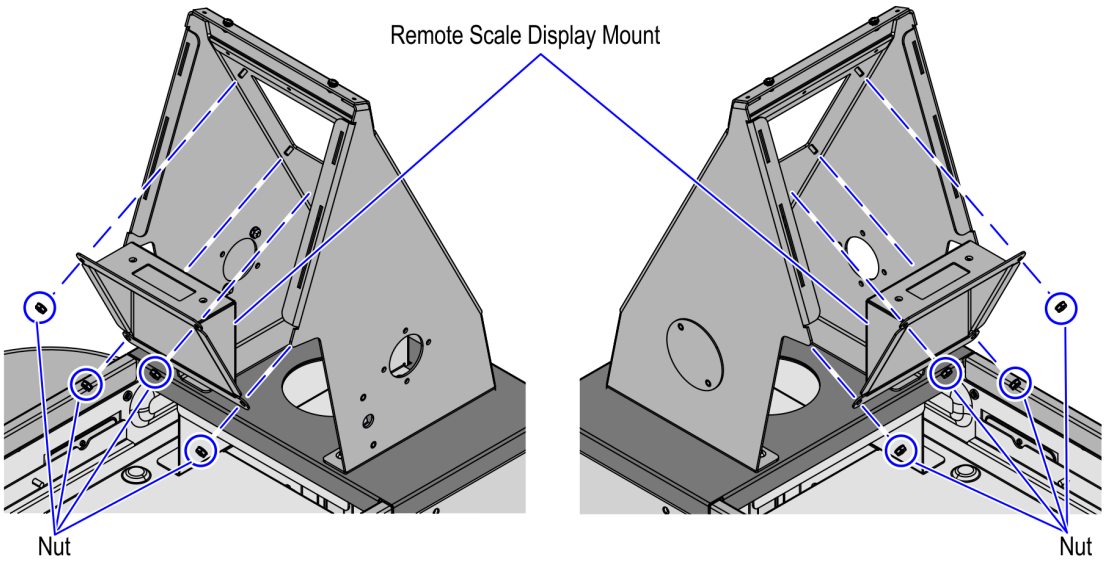

CCP-79735

7. Insert the Remote Scanner Display Cable into the Cable Access Hole of the Remote Scale Display Mount and route it to the hole going down the back of the Core Cabinet, as shown in the image below.

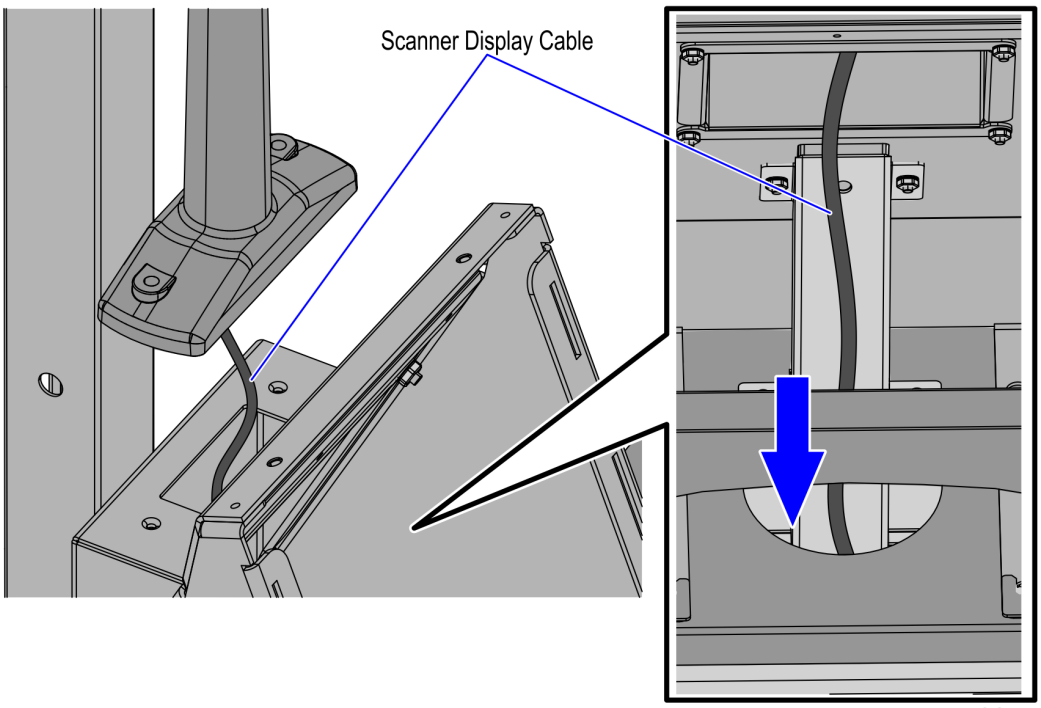

CCP-79782

8. Secure the Remote Scale Display to the Mount using two (2) M4 screws.

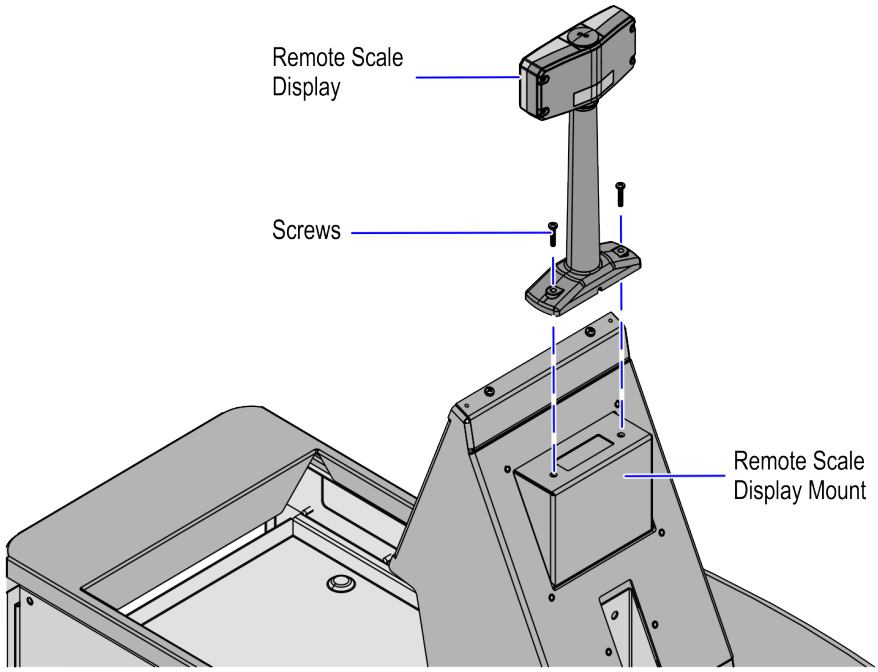

CCP-79738

9. Route the Remote Scale Display Cable to the Scanner Bucket.

Note: Secure the Remote Scale Display Cable with the 7895 Scanner/Scale Cable and the Color Camera Cable to the air vent using a cable tie.

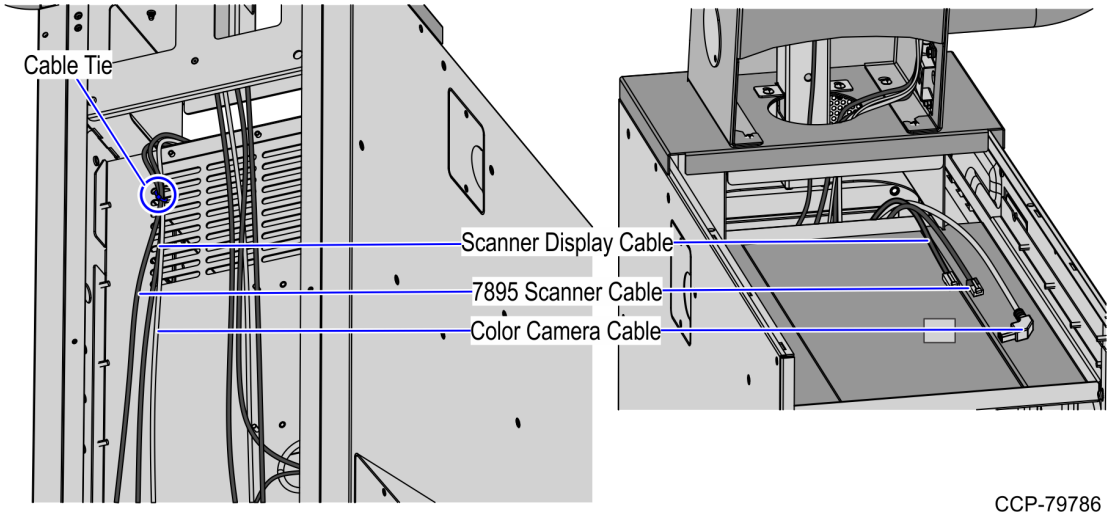

10. Install the NCR 7895 Scanner/Scale by doing the following:

    a. Connect all the cables on the designated ports on the NCR 7895 Scanner/Scale.

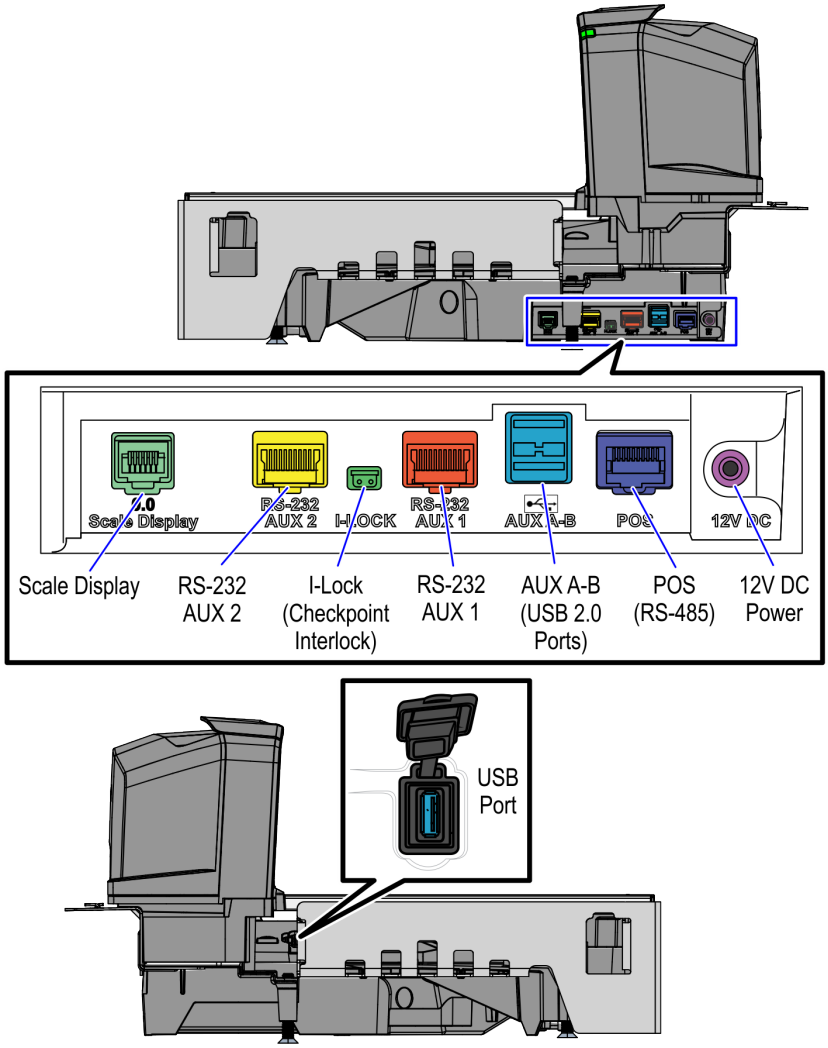

b. Place the Scanner/Scale in the Scanner bucket.

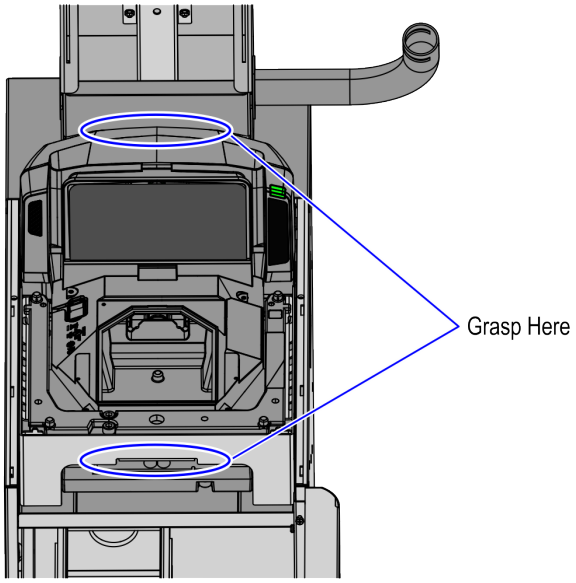

CCP-79777

c. Lower the Scale Plate.

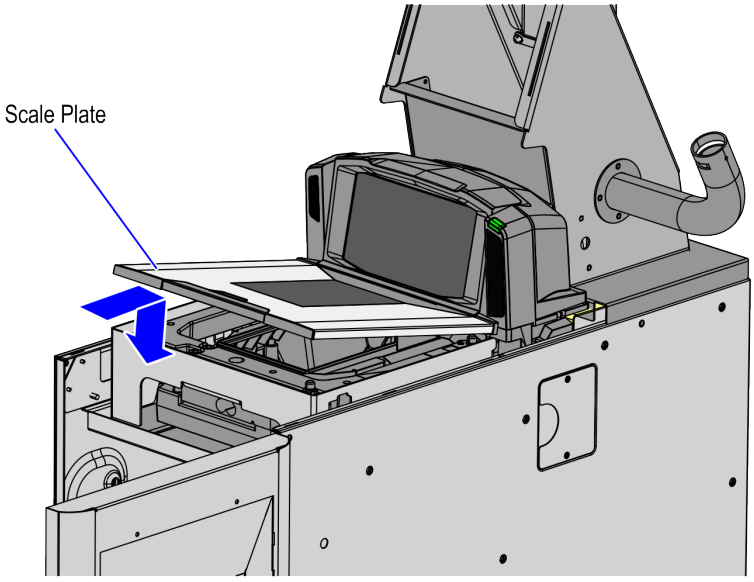

CCP-79781

d. Install the Scanner Top by sliding it toward the Tower Frame.

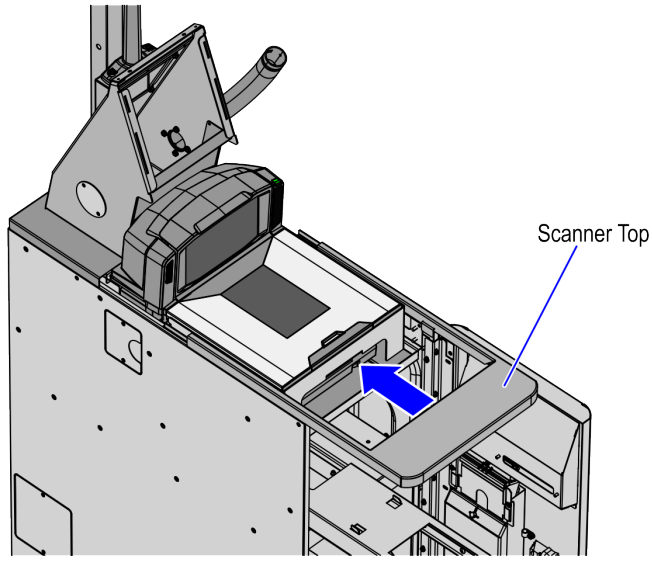

CCP-79780

e. Connect cables to designated ports on the Display.

11. Install the Terminal Display to the Tower Frame, by doing the following:

a. Align hooks in mounting bracket to the holes in the Tower Frame and slide down the Display to lock in place. Align hooks of Mounting Bracket at the back of the Terminal Display to the holes in the Tower Frame and then slide down the Display to lock in place.

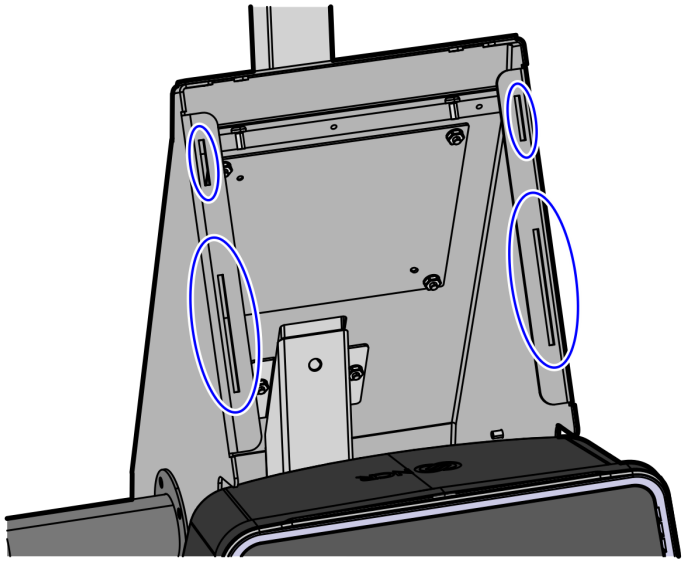

CCP-73414

12. Secure the Terminal Display to the Tower Frame using two (2) screws.

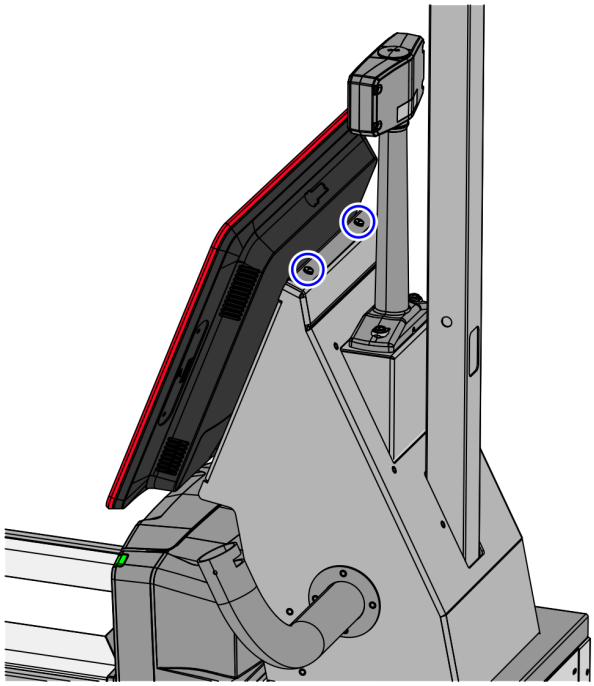

CCP-79787

13. Ensure that the devices are working properly by powering up the NCR FastLane SelfServ™ Checkout software and hardware systems.