NCR VOYIX
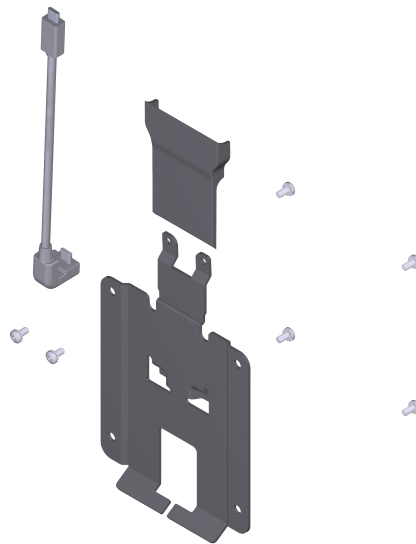
XL10 Mounting Bracket with Cable

Kit Instructions

7772-K455

Issue C

Copyright

The product described in this document is a licensed product of NCR Voyix Corporation.

NCR CX7 All-in-One POS (7772) is a trademark of NCR Voyix Corporation in the United States and/or other countries. Other product names mentioned in this publication may be trademarks or registered trademarks of their respective companies and are hereby acknowledged.

Where creation of derivative works, modifications or copies of this NCR Voyix copyrighted documentation is permitted under the terms and conditions of an agreement you have with NCR Voyix, NCR Voyix's copyright notice must be included.

It is the policy of NCR Voyix Corporation to improve products as new technology, components, software, and firmware become available. NCR Voyix, therefore, reserves the right to change specifications without prior notice.

All features, functions, and operations described herein may not be marketed by NCR Voyix in all parts of the world. In some instances, photographs are of equipment prototypes. Therefore, before using this document, consult with your NCR Voyix representative or NCR Voyix office for information that is applicable and current.

Table of Contents

Revision Record

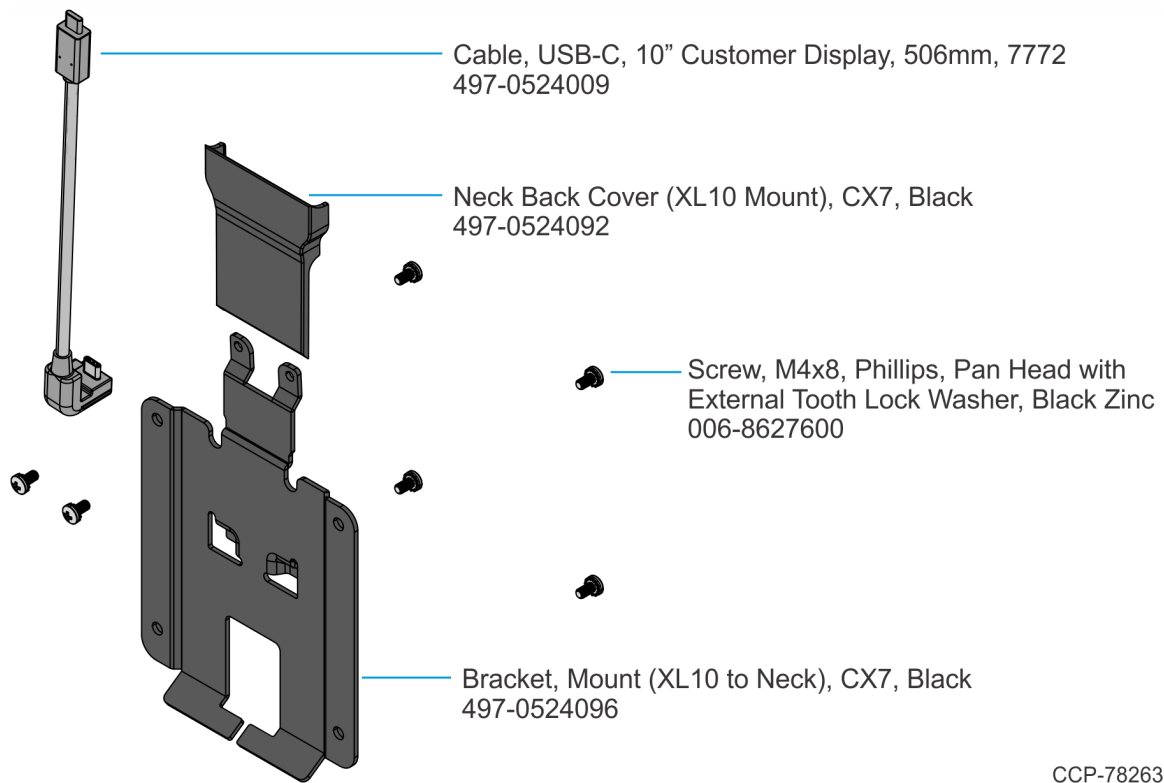| Issue	Date	Remarks
A	Jun 2020	First Issue
B	Aug 2020	Updated XL10 cable routing
C	Dec 2021	Added Warning statement

XL10 Mounting Bracket with Cable

This kit provides a mounting bracket and cable to install the XL10 Customer Display on the neck of the NCR CX7 All-in-One POS (7772).
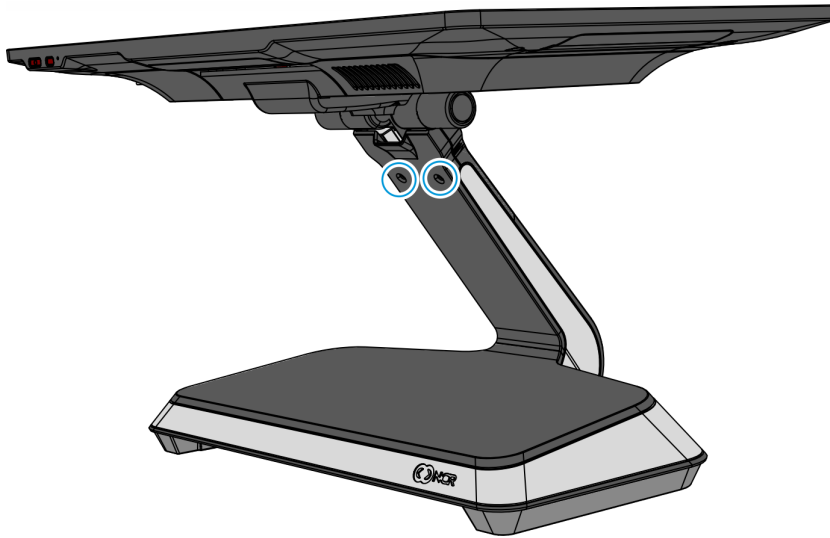
Kit Contents

Cable, USB-C, 10" Customer Display, 506mm, 7772
497-0524009

Neck Back Cover (XL10 Mount), CX7, Black
497-0524092

Screw, M4x8, Phillips, Pan Head with External Tooth Lock Washer, Black Zinc
006-8627600

Bracket, Mount (XL10 to Neck), CX7, Black
497-0524096

CCP-78263

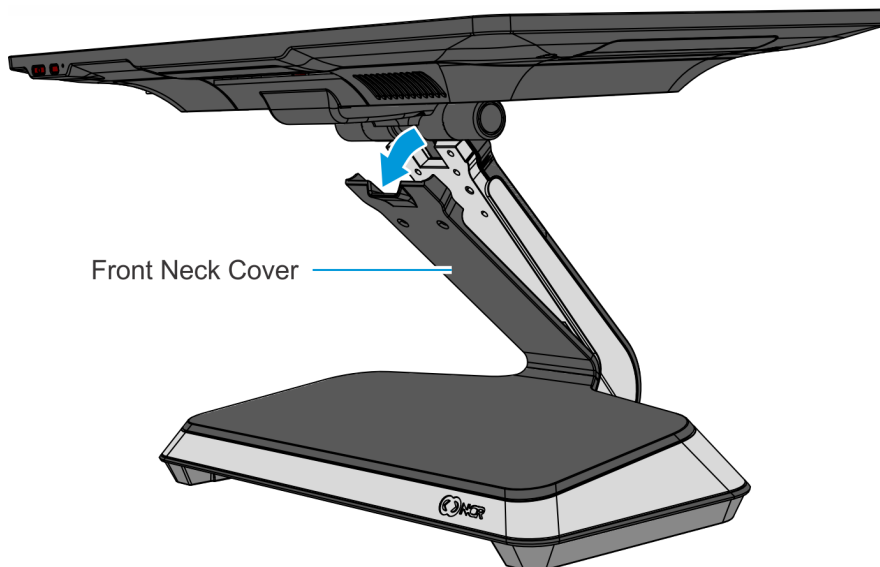# Installation Procedure

> ⚠️ **Warning**
>
> Disconnect the AC power cord from the AC outlet and wait 30 seconds before servicing the terminal.

1. Remove the two (2) screws that secure the Front Neck Cover to the Neck.

   a. flat head screws for Base without Integrated Power Supply

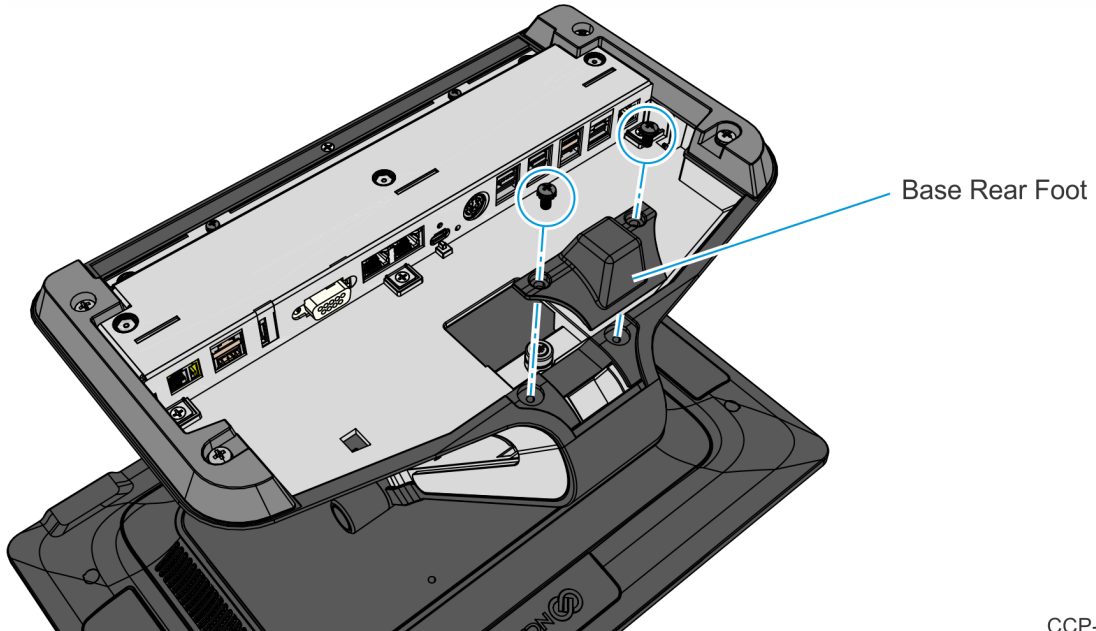   b. thumbscrews for Base with Integrated Power Supply

CCP-76947

2. Pivot the Front Neck Cover away from the Neck.

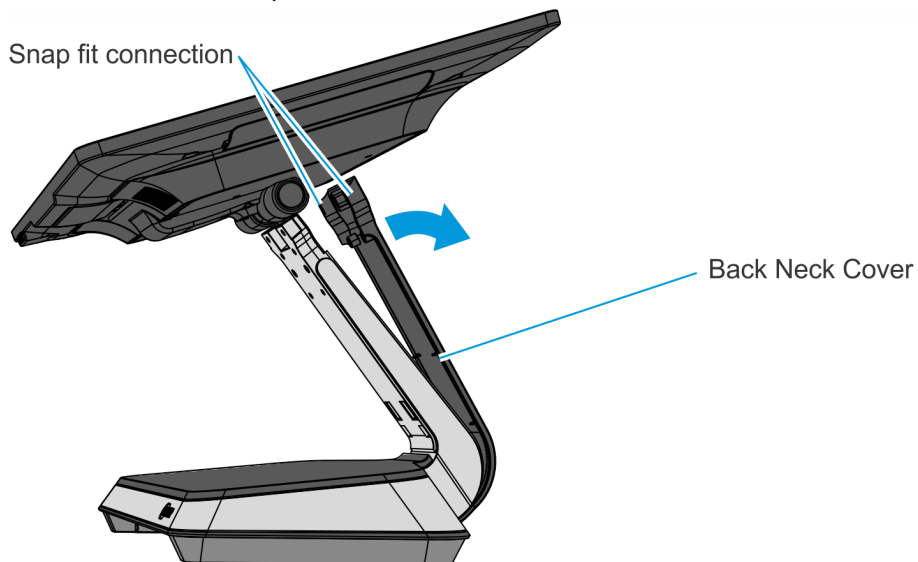Front Neck Cover

CCP-76948

3. Lay the Display face down on a flat surface.

   Always use a soft material (cloth, foam) to protect the display screen when placing the terminal face down.

4. Remove the Base Rear Foot (2 screws).

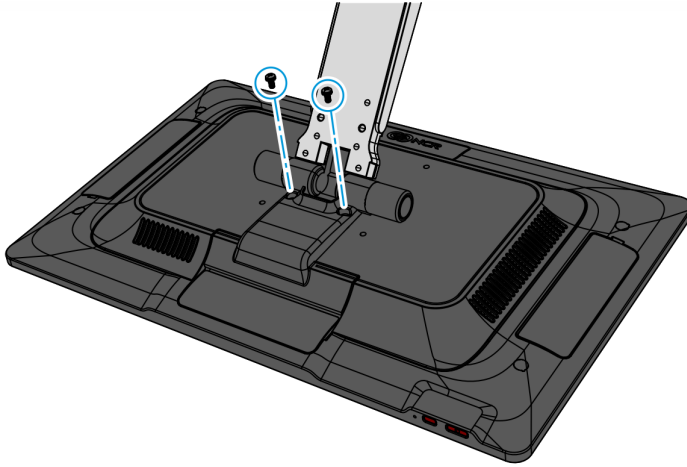Base Rear Foot

CCP-76953

5. Pivot the Back Neck Cover away from the Neck. The Cover has a simple snap fit connection at the top.
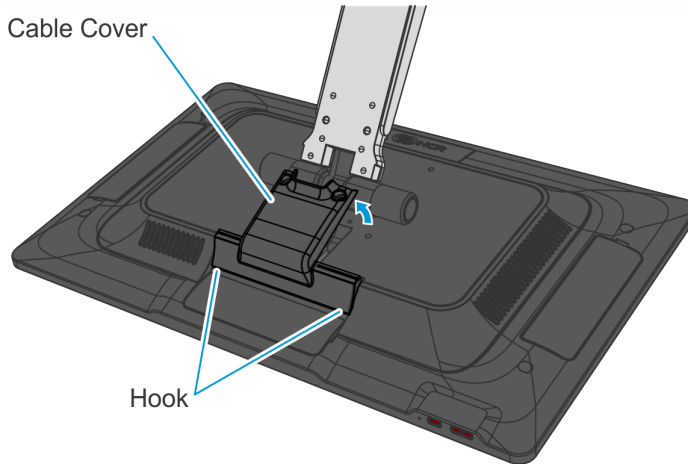

Snap fit connection

Back Neck Cover

CCP-76954

6. Remove the Cable Cover.

   a. Remove the two (2) screws that secure the Cable Cover to the Back Cover.
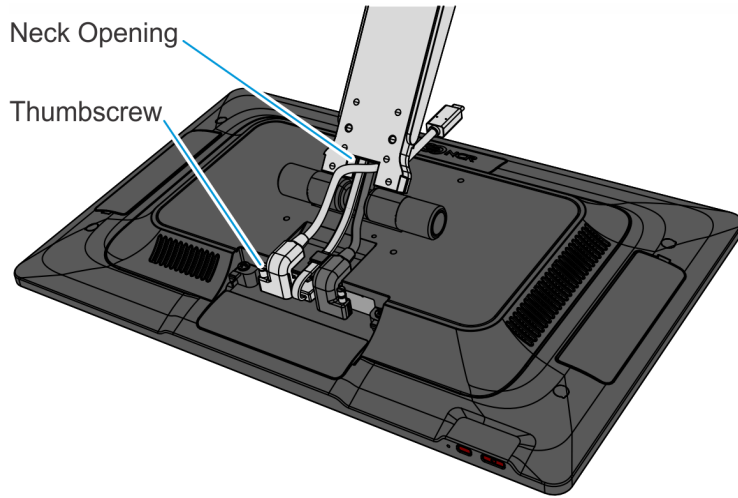

CCP-78295

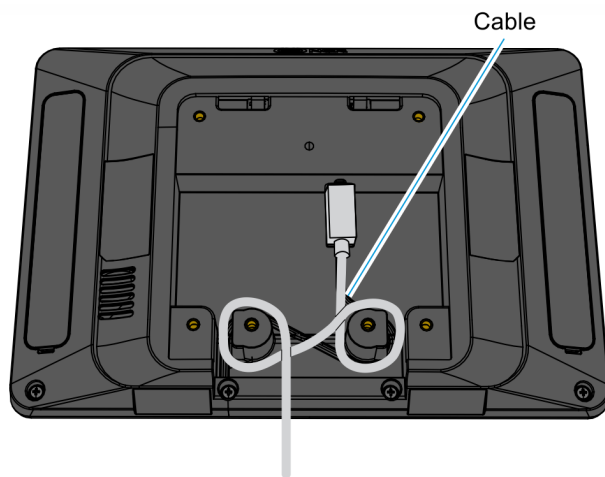   b. Rotate and unhook the Cable Cover from the Back Cover.

Cable Cover

Hook

CCP-78296

7. Route the USB-C Cable through the Neck opening, then connect the USB-C Cable on the CX7 Display and tighten the thumbscrew.
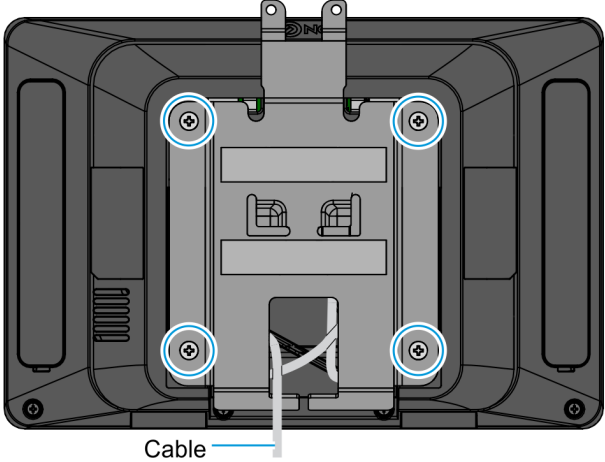

Neck Opening

Thumbscrew

CCP-78267

8. Connect the other end of the Cable to the back of the XL10 Display and route the Cable around the cable strain relief posts as shown.

Cable

CCP-79548

9. Route the Cable through the Bracket as shown and install the Bracket on the back of the XL10 Display (4 screws).
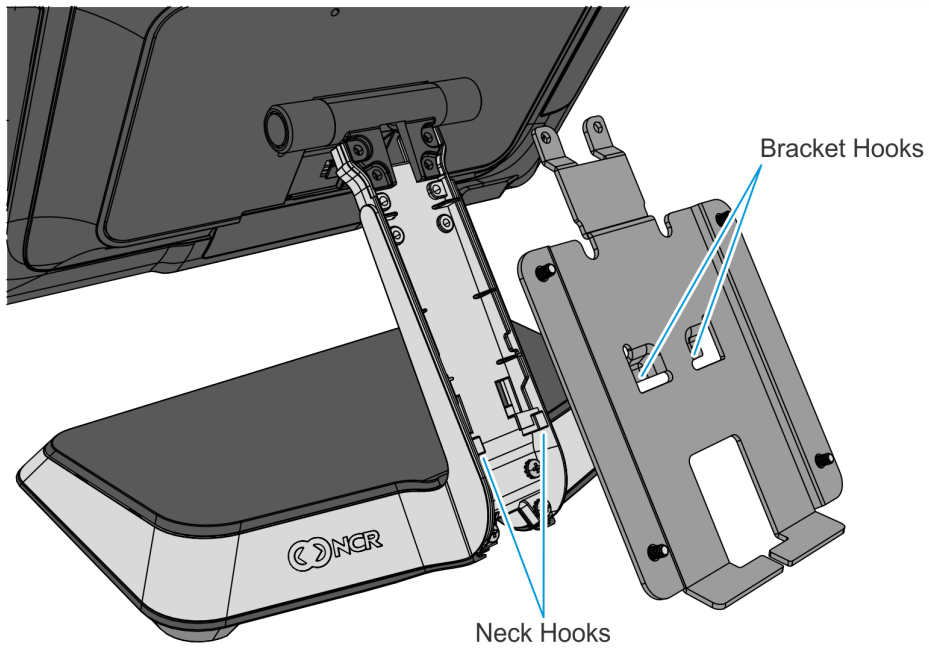

Cable

CCP-79556

10. Install the XL10 Display and Bracket assembly on the Neck.
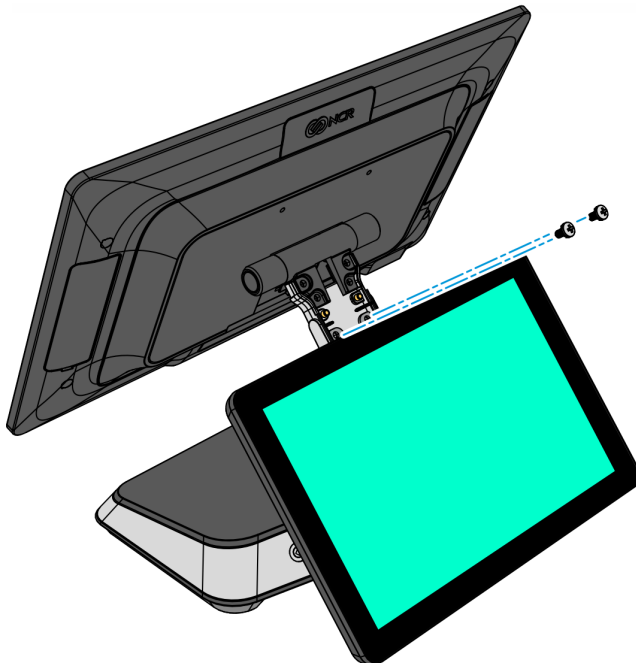
   a. Insert the Bracket Hooks on the Neck.

      For clarity, the XL10 Display is not shown in the illustration.

Bracket Hooks

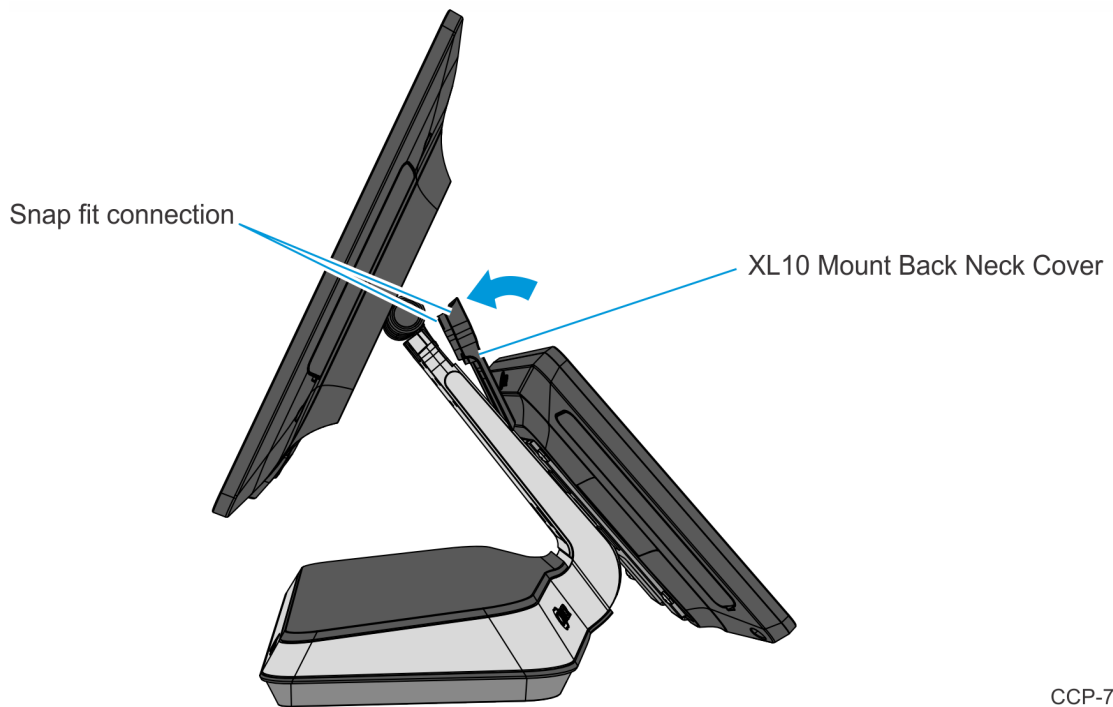Neck Hooks

CCP-78269

   b. Secure the Bracket to the Neck with two (2) screws.

      Ensure no cables are pinched.

CCP-78270

11. Mount the XL10 Mount Back Neck Cover on the Neck. The Cover has a simple snap fit connection at the top.

Snap fit connection

XL10 Mount Back Neck Cover

CCP-78271

12. Reinstall the Base Rear Foot.

13. Reinstall the Cable Cover.

14. Reinstall the Front Neck Cover.